

**U2IrDA**  
**(USB to IrDA Adapter)**  
**Installation Guide**


*(Jan.21,2002)*

# Contents


<b>Windows 98, Windows ME, Windows 2000 Installation .....</b>	<b>3</b>
<b>Windows XP Installation Notes .....</b>	<b>7</b>

# Windows 98, Windows ME, Windows 2000 and Windows XP driver Installation


1. Insert the driver CD-ROM and run setup.exe. The following window will appear

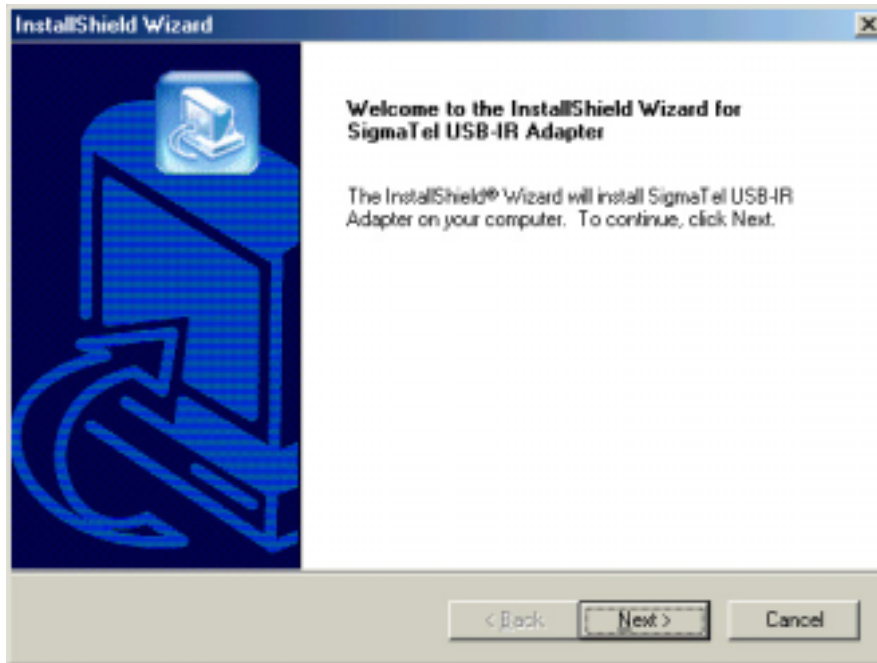


2. Insert the U2 IrDA adapter to the USB port. The following window appear. Click on "**NEXT**" to continue. The following window appear.

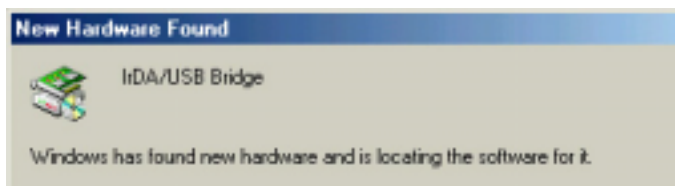


3. Click on "NEXT" to continue.

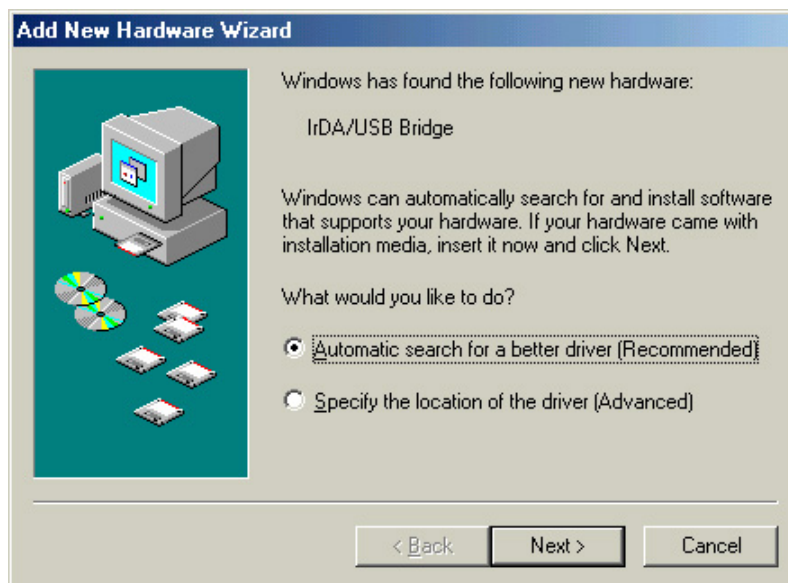


4. Click on "Next" to continue.

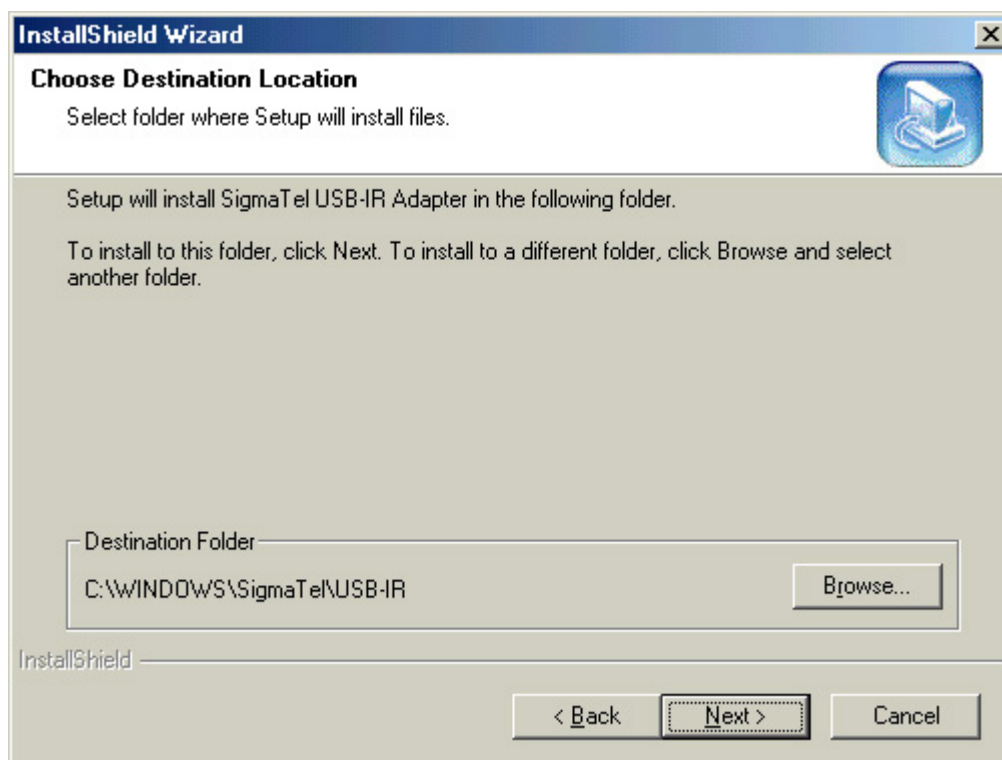


5. Click on “Finish” to complete installation.

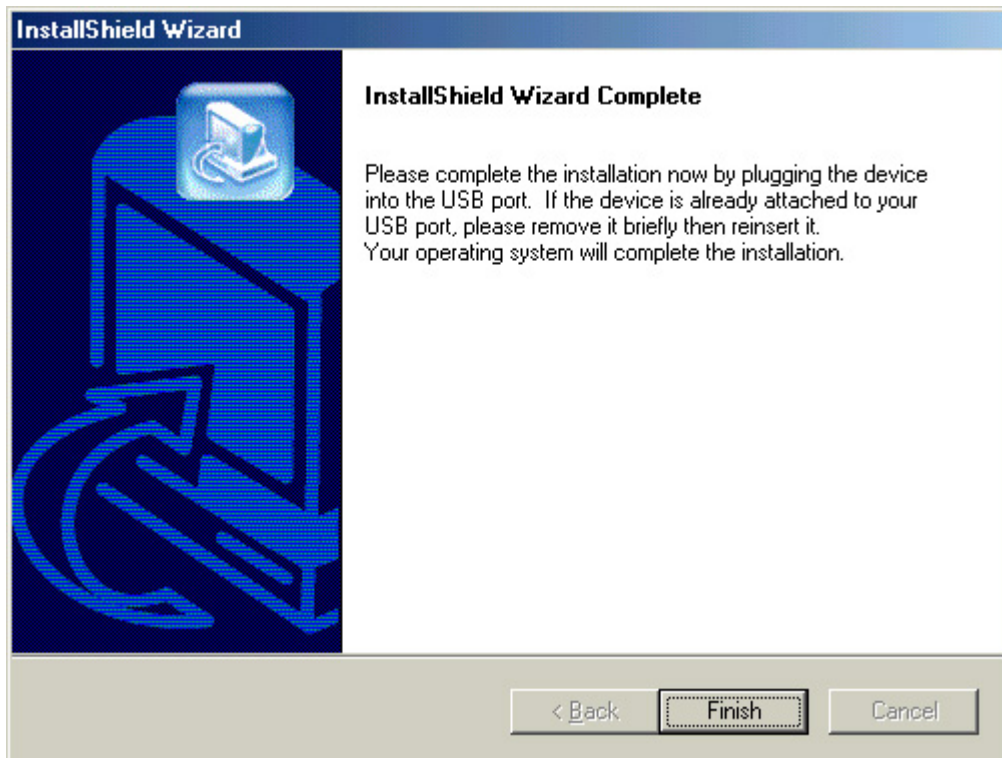


6. Wait for a few seconds while system files are installed.

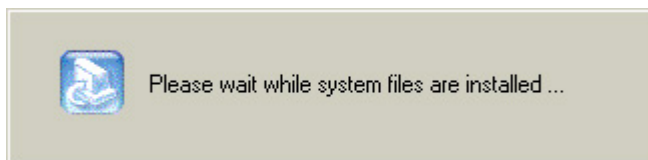


7. The following window appears. Click on “Finish” to restart your computer.

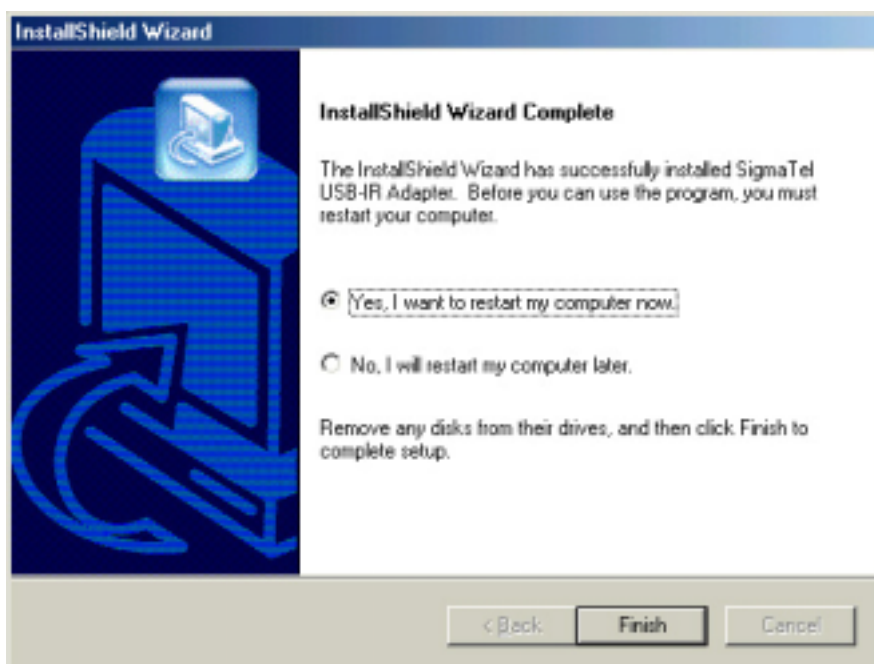

8. Verify the Installation by checking the System Property. The Infrared Communication Device should appear below the Infrared devices.

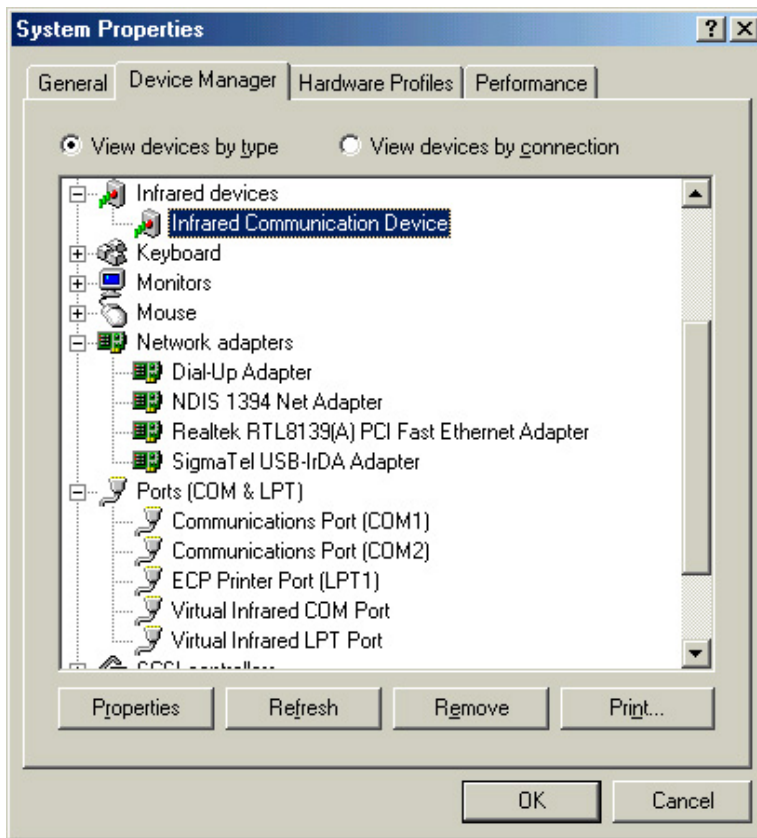

9. The “**Sigmatel USB-IrDA Adapter**” appears in the network component window

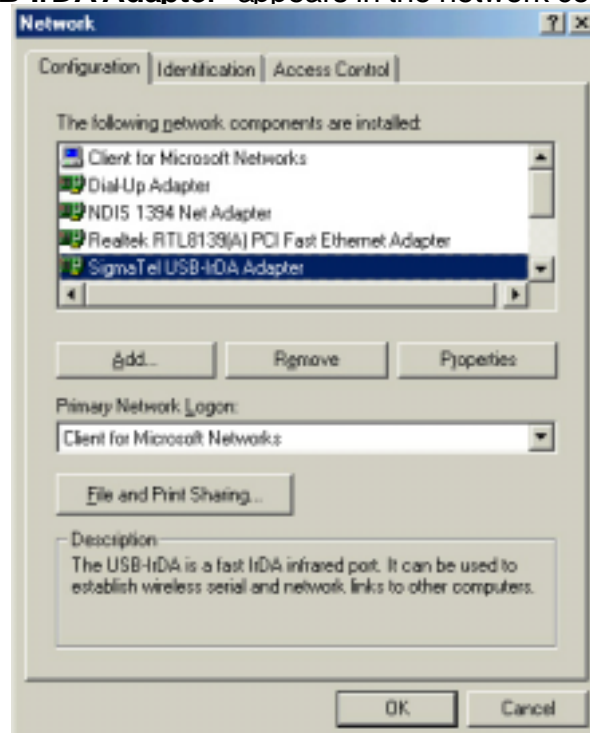

10. U2 IrDA installation is finish.

# Windows XP driver Installation Notice

Windows XP has included a driver for U2 IrDA adapter. However, we suggest user to update it by installing the new driver.